



Dimensional Documentation


PEX Press Fittings

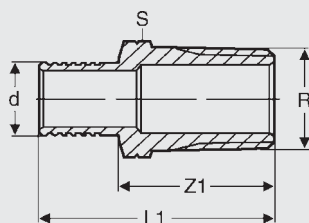

Bronze PEX Press Male NPT Adapters							
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	S (in)	S (mm)
60505	3/8" PEX Press x 1/2" M NPT	1.77	45.0	1.18	30.0	0.87	22.0
60520	1/2" PEX Press x 1/2" M NPT	1.73	44.0	1.14	29.0	0.87	22.0
60525	1/2" PEX Press x 3/4" M NPT	1.77	45.0	1.18	30.0	1.06	27.0
60542	3/4" PEX Press x 1/2" M NPT	1.57	40.0	0.98	25.0	0.87	22.0
60540	3/4" PEX Press x 3/4" M NPT	1.77	45.0	1.18	30.0	1.06	27.0
60545	3/4" PEX Press x 1" M NPT	2.05	52.0	1.45	37.0	1.34	34.0
60555	1" PEX Press x 3/4" M NPT	1.93	49.0	1.18	30.0	1.06	27.0
60560	1" PEX Press x 1" M NPT	2.15	54.5	1.40	35.5	1.34	34.0
60570	1-1/4" PEX Press x 1-1/4" M NPT	2.44	62.0	1.50	38.0	1.73	44.0
60580	1-1/2" PEX Press x 1-1/2" M NPT	2.56	65.0	1.61	41.0	1.97	50.0

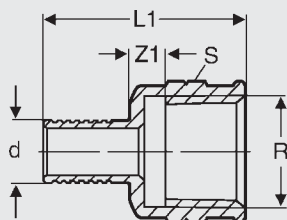


Bronze PEX Press Female NPT Adapters							
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	S (in)	S (mm)
61520	1/2" PEX Press x 1/2" F NPT	1.36	34.5	0.80	19.5	0.98	25.0
61525	1/2" PEX Press x 3/4" F NPT	1.40	35.5	0.81	20.5	1.20	30.5
61540	3/4" PEX Press x 3/4" F NPT	1.40	35.5	0.81	20.5	1.20	30.5
61545	1" PEX Press x 3/4" F NPT	1.56	39.5	0.81	20.5	1.20	30.5
61560	1" PEX Press x 1" F NPT	1.67	42.5	0.93	23.5	1.48	37.5

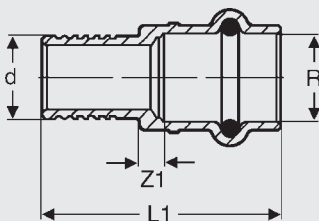


Bronze PEX Press ProPress Adapters					
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
67620	1/2" PEX Press x 1/2" C	1.57	40.0	0.24	6.0
67626	1/2" PEX Press x 3/4" C	1.83	46.5	0.49	12.5
67630	3/4" PEX Press x 1/2" C	1.42	36.0	0.08	2.0
67640	3/4" PEX Press x 3/4" C	1.73	44.0	0.24	6.0
67660	1" PEX Press x 1" C	1.97	50.0	0.31	8.0
67670	1-1/4" PEX Press x 1-1/4" C	2.26	57.5	0.22	5.5
67680	1-1/2" PEX Press x 1-1/2" C	2.76	70.0	0.24	6.0

Dimensional Documentation


PEX Press Fittings

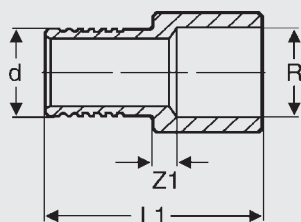

Bronze PEX Press Copper Tubing Adapters (female)					
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
62005	3/8" PEX Press x 1/2" Copper	1.26	32.0	0.17	4.35
62020	1/2" PEX Press x 1/2" Copper	1.22	31.0	0.13	3.35
62025	1/2" PEX Press x 3/4" Copper	1.50	38.0	0.16	4.0
62035	3/4" PEX Press x 1/2" Copper	1.16	29.5	0.08	2.0
62040	3/4" PEX Press x 3/4" Copper	1.75	44.5	0.26	6.5
62045	3/4" PEX Press x 1" Copper	1.50	38.0	0.16	4.0
62060	1" PEX Press x 1" Copper	1.85	47.0	0.20	5.0
62070	1-1/4" PEX Press x 1-1/4" Copper	2.17	55.0	0.24	6.0
62080	1-1/2" PEX Press x 1-1/2" Copper	2.30	58.5	0.26	6.5

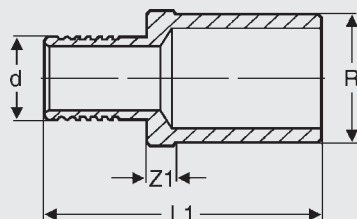


Bronze PEX Press Copper Fitting Adapters (male)					
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
67520	1/2" PEX Press x 1/2" Copper	1.56	39.5	0.18	4.5
67525	1/2" PEX Press x 3/4" Copper	1.73	44.0	0.19	4.7
67535	3/4" PEX Press x 1/2" Copper	1.59	40.5	0.19	4.7
67540	3/4" PEX Press x 3/4" Copper	1.73	44.0	0.18	4.5
67545	3/4" PEX Press x 1" Copper	1.73	44.0	0.18	4.5
67560	1" PEX Press x 1" Copper	1.89	48.0	0.18	4.5
67570	1-1/4" PEX Press x 1-1/4" Copper	2.38	60.5	0.37	9.5
67580	1-1/2" PEX Press x 1-1/2" Copper	2.76	70.0	0.31	8.0

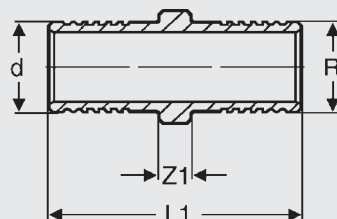


Bronze PEX Press PB Adapters					
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
67820	1/2" PEX Press x 1/2" PB	1.36	34.5	0.16	4.0
67840	3/4" PEX Press x 3/4" PB	1.36	34.5	0.16	4.0

Dimensional Documentation


PEX Press Fittings

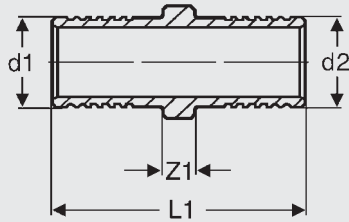

Bronze PEX Press Couplings					
Stock Code	d1 x d2 (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
63000	3/8" PEX Press	1.34	34.0	0.16	4.0
63020	1/2" PEX Press	1.34	34.0	0.16	4.0
63040	3/4" PEX Press	1.34	34.0	0.16	4.0
63050	1/2" x 3/4" PEX Press	1.34	34.0	0.16	4.0
63055	3/4" x 1" PEX Press	1.50	38.0	0.16	4.0
63060	1" PEX Press	1.65	42.0	0.16	4.0
63065	1" x 1-1/4" PEX Press	1.89	48.0	0.20	5.0
63070	1-1/4" PEX Press	2.17	55.0	0.28	7.0
63071	3/4" x 1-1/4" PEX Press	1.73	44.0	0.20	5.0
63072	3/4" x 1-1/2" PEX Press	1.73	44.0	0.20	5.0
63073	1" x 1-1/2" PEX Press	1.89	48.0	0.20	5.0
63075	1-1/4" x 1-1/2" PEX Press	2.09	53.0	0.20	5.0
63080	1-1/2" PEX Press	2.17	55.0	0.28	7.0

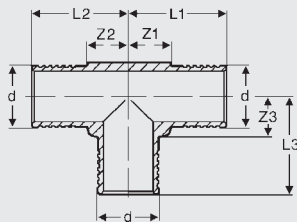


Bronze PEX Press Tees													
Stock Code	d (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	L2 (in)	L2 (mm)	Z2 (in)	Z2 (mm)	L3 (in)	L3 (mm)	Z3 (in)	Z3 (mm)
64020	1/2" PEX Press	0.93	23.5	0.33	8.5	0.93	23.5	0.33	8.5	0.93	23.5	0.33	8.5
64040	3/4" PEX Press	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7
64060	1" PEX Press	1.57	40.0	0.83	21.0	1.57	40.0	0.83	21.0	1.57	40.0	0.83	21.0
64070	1-1/4" PEX Press	1.73	44.0	0.79	20.0	1.73	44.0	0.79	20.0	1.73	44.0	0.79	20.0
64080	1-1/2" PEX Press	1.87	47.5	0.93	23.5	1.87	47.5	0.93	23.5	1.87	47.5	0.93	23.5

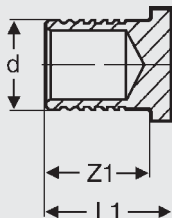


Bronze PEX Press Test Plugs					
Stock Code	d (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
65000	3/8" PEX Press	0.71	18.0	0.59	15.0
65020	1/2" PEX Press	0.71	18.0	0.59	15.0
65040	3/4" PEX Press	0.71	18.0	0.59	15.0
65060	1" PEX Press	0.91	23.0	0.75	19.0

Dimensional Documentation


PEX Press Fittings

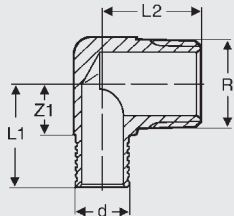

Bronze PEX Press Male NPT Elbows							
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	L2 (in)	L2 (mm)
62520	1/2" PEX Press x 1/2" M NPT	1.10	28.0	0.51	13.0	1.14	29.8
62525	1/2" PEX Press x 3/4" M NPT	1.22	30.9	0.63	15.9	1.26	31.9
62540	3/4" PEX Press x 3/4" M NPT	1.22	30.9	0.63	15.9	1.26	31.9
62545	3/4" PEX Press x 1" M NPT	1.50	38.0	0.91	23.0	2.24	57.0
62560	1" PEX Press x 1" M NPT	1.61	41.0	0.87	22.0	2.28	58.0

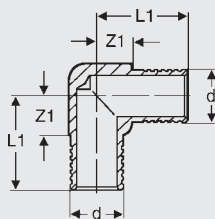


Bronze PEX Press Elbows					
Stock Code	d x d (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
63520	1/2" PEX Press	0.93	23.5	0.33	8.5
63540	3/4" PEX Press	1.05	26.7	0.46	11.7
63560	1" PEX Press	1.57	40.0	0.83	21.0
63570	1-1/4" PEX Press	1.74	44.3	0.80	20.3
63580	1-1/2" PEX Press	1.88	47.8	0.94	23.8

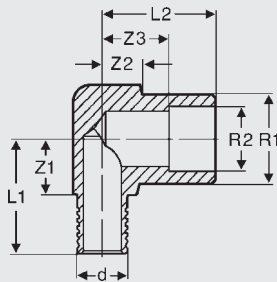

Bronze PEX Press Copper Tubing Elbows											
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	L2 (in)	L2 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)
19307	1/2" PEX Press x 1/2" Copper (female) or 3/4" Copper (male)	1.05	26.7	0.46	11.7	1.06	26.9	0.48	12.1	~	~
19308	1/2" PEX Press x 3/4" Copper (female)	1.16	29.4	0.57	14.4	1.22	31.0	~	~	0.47	12.0
19309	3/4" PEX Press x 3/4" Copper (female)	1.16	29.4	0.57	14.4	1.22	31.0	~	~	0.47	12.0
19310	1/2" PEX Press x 1/2" Copper (female)	1.05	26.7	0.46	11.7	1.06	26.9	0.48	12.1	~	~
19311	3/4" PEX Press x 1/2" Copper (female) or 3/4" Copper (male)	1.16	29.4	0.57	14.4	1.23	31.3	0.43	10.8	0.73	18.5

Dimensional Documentation


PEX Press Fittings

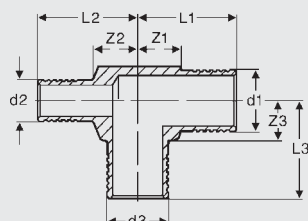


Bronze PEX Press Reducing Tees													
Stock Code	d1 x d2 x d3 (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	L2 (in)	L2 (mm)	Z2 (in)	Z2 (mm)	L3 (in)	L3 (mm)	Z3 (in)	Z3 (mm)
64021	1/2" x 3/8" x 3/8" PEX Press	0.93	23.5	0.33	8.5	0.93	23.5	0.33	8.5	0.93	23.5	0.33	8.5
64022	1/2" x 1/2" x 3/4" PEX Press	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7
64032	3/4" x 1/2" x 1/2" PEX Press	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7
64034	3/4" x 1/2" x 3/4" PEX Press	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7
64036	3/4" x 3/4" x 1/2" PEX Press	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7	1.05	26.7	0.46	11.7
64037	1" x 1/2" x 1/2" PEX Press	1.54	39.0	0.79	20.0	1.46	37.0	0.87	22.0	1.46	37.0	0.87	22.0
64038	1" x 3/4" x 1/2" PEX Press	1.42	36.0	0.67	17.0	1.26	32.0	0.67	17.0	1.46	37.0	0.87	22.0
64039	1" x 1/2" x 1" PEX Press	1.57	40.0	0.83	21.0	1.50	38.0	0.91	23.0	1.57	40.0	0.83	21.0
64050	1" x 1" x 1/2" PEX Press	1.57	40.0	0.83	21.0	1.57	40.0	0.83	21.0	1.57	40.0	0.98	25.0
64052	1" x 3/4" x 3/4" PEX Press	1.57	40.0	0.83	21.0	1.54	39.0	0.79	20.0	1.54	39.0	0.94	24.0
64053	1" x 3/4" x 1" PEX Press	1.57	40.0	0.83	21.0	1.42	36.0	0.83	21.0	1.57	40.0	0.83	21.0
64056	1" x 1" x 3/4" PEX Press	1.57	40.0	0.83	21.0	1.57	40.0	0.83	21.0	1.54	39.0	0.94	24.0
64071	1-1/4" x 1" x 3/4" PEX Press	1.48	37.5	0.53	13.5	1.28	32.5	0.53	13.5	1.38	35.0	0.79	20.0
64072	1-1/4" x 1-1/4" x 3/4" PEX Press	1.48	37.5	0.53	13.5	1.48	37.5	0.53	13.5	1.38	35.0	0.79	20.0
64073	1-1/4" x 1" x 1" PEX Press	1.59	40.5	0.65	16.5	1.40	35.5	0.65	16.5	1.54	39.0	0.79	20.0
64074	1-1/4" x 1-1/4" x 1" PEX Press	1.59	40.5	0.65	16.5	1.59	40.5	0.65	16.5	1.54	39.0	0.79	20.0
64081	1-1/2" x 1" x 3/4" PEX Press	1.48	37.5	0.53	13.5	1.30	33.0	0.55	14.0	1.52	38.5	0.93	23.5
64082	1-1/2" x 1" x 1" PEX Press	1.59	40.5	0.65	16.5	1.44	36.5	0.69	17.5	1.67	42.5	0.93	23.5
64083	1-1/2" x 1-1/2" x 3/4" PEX Press	1.48	37.5	0.53	13.5	1.48	37.5	0.53	13.5	1.48	37.5	0.89	22.5
64084	1-1/2" x 1-1/2" x 1" PEX Press	1.59	40.5	0.65	16.5	1.59	40.5	0.65	16.5	1.67	42.5	0.93	23.5
64085	1-1/2" x 1-1/2" x 1-1/4" PEX Press	1.73	44.0	0.79	20.0	1.73	44.0	0.79	20.0	1.87	47.5	0.93	23.5

Dimensional Documentation

PEX Press Fittings

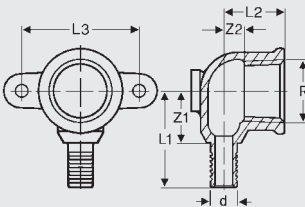


Bronze PEX Press Drop Ear Elbows											
Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	L3 (in)	L3 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)
64505	3/8" PEX Press x 1/2" F NPT	1.28	32.5	0.81	20.5	1.57	40.0	0.69	17.5	0.27	6.9
64520	1/2" PEX Press x 1/2" F NPT	1.28	32.5	0.81	20.5	1.57	40.0	0.69	17.5	0.27	6.9
64535	3/4" PEX Press x 1/2" F NPT	1.42	36.0	0.91	23.0	1.57	40.0	0.83	21.0	0.37	9.3
64540	3/4" PEX Press x 3/4" F NPT	1.42	36.0	0.96	24.5	1.77	45.0	0.83	21.0	0.41	10.5

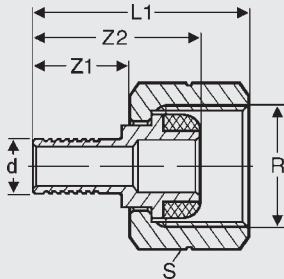

Bronze PEX Press Lav Adapters									
Stock Code	d (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	S (in)	S (mm)
57002	3/8" PEX Press	1.44	36.5	0.59	15.0	1.12	28.5	1.00	25.4
57003	1/2" PEX Press	1.44	36.5	0.59	15.0	1.12	28.5	1.00	25.4

Note: Metal Nut

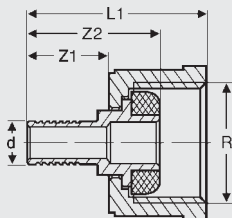


Bronze PEX Press Closet Adapters							
Stock Code	d (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)
57004	3/8" PEX Press	1.48	37.5	0.59	15.0	1.12	28.5
57005	1/2" PEX Press	1.48	37.5	0.59	15.0	1.12	28.5


Note: Plastic Nut

Dimensional Documentation


PEX Press Fittings

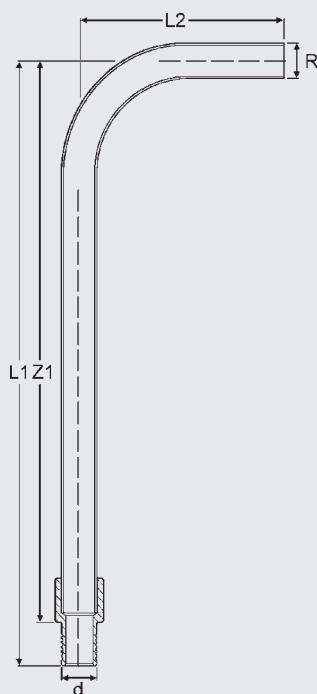

Press Copper Tub Els							
Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)
62220	1/2" PEX x 1/2" Copper (3" x 6")	6.72	171.0	3.00	76.2	6.13	156.0

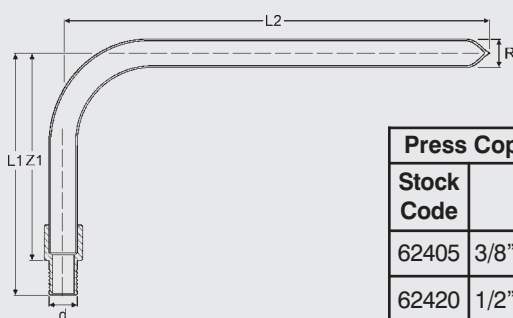


Press Copper Stub Outs							
Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)
62405	3/8" PEX x 1/2" Copper (3-1/2" x 8")	4.22	107.0	8.00	203.0	3.63	92.2
62420	1/2" PEX x 1/2" Copper (3-1/2" x 8")	4.22	107.0	8.00	203.0	3.63	92.2




Press Copper Straight Stub Outs					
Stock Code	d x R (size)	L1 (in)	L1 (mm)	Z1 (in)	Z1 (mm)
62608	1/2" PEX x 1/2" Copper (8")	8.59	218.0	8.00	203.0
62615	1/2" PEX x 1/2" Copper (15")	15.59	396.0	15.00	381.0

Dimensional Documentation

PEX Press Fittings

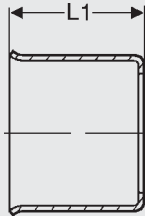


Stainless Steel PEX Press Sleeves			
Stock Code	d (size)	L1 (in)	L1 (mm)
61000	3/8" PEX Press	0.59	15.0
61020	1/2" PEX Press	0.59	15.0
61040	3/4" PEX Press	0.59	15.0
61060	1" PEX Press	0.75	19.0
61070	1-1/4" PEX Press	0.94	24.0
61080	1-1/2" PEX Press	0.94	24.0

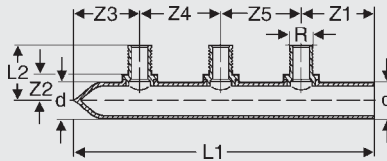

Braided PEX Press Copper Manifolds - male															
Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)	Z4 (in)	Z4 (mm)	Z5 (in)	Z5 (mm)
65703	1" CM x 1/2" PEX Press, 3 outlets	8.25	209.6	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65704	1" CM x 1/2" PEX Press, 4 outlets	10.25	260.4	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65705	1" CM x 1/2" PEX Press, 5 outlets	12.25	311.2	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65706	1" CM x 1/2" PEX Press, 6 outlets	14.25	362.0	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65708	1" CM x 1/2" PEX Press, 8 outlets	18.25	463.6	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65710	1" CM x 1/2" PEX Press, 10 outlets	22.25	565.2	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65712	1" CM x 1/2" PEX Press, 12 outlets	26.25	666.8	1.44	36.6	2.05	52.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8

Note: CM = Copper Male

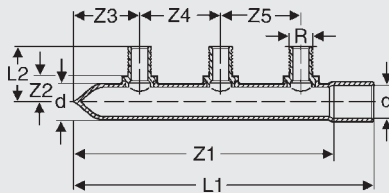

Braided PEX Press Copper Manifolds - female															
Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)	Z4 (in)	Z4 (mm)	Z5 (in)	Z5 (mm)
65603	1" CF x 1/2" PEX Press, 3 outlets	8.25	209.6	1.44	36.6	7.20	182.9	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65604	1" CF x 1/2" PEX Press, 4 outlets	10.25	260.4	1.44	36.6	9.20	233.7	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65605	1" CF x 1/2" PEX Press, 5 outlets	12.25	311.2	1.44	36.6	11.20	284.5	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65606	1" CF x 1/2" PEX Press, 6 outlets	14.25	362.0	1.44	36.6	13.20	335.3	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65608	1" CF x 1/2" PEX Press, 8 outlets	18.25	463.6	1.44	36.6	17.20	436.9	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65610	1" CF x 1/2" PEX Press, 10 outlets	22.25	565.2	1.44	36.6	21.20	538.5	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8
65612	1" CF x 1/2" PEX Press, 12 outlets	26.25	666.8	1.44	36.6	25.20	640.1	0.85	21.6	2.20	55.9	2.00	50.8	2.00	50.8


Note: CF = Copper Female

VIEGA • One Company... One Partner... Delivering System Solutions.

301 N. Main, Floor 9 • Wichita, KS 67202 • Ph: 877-Viega-NA • Fax: 1-800-976-9817 • E-Mail: service@viega.com • www.viega-na.com

Dimensional Documentation


PEX Press Fittings

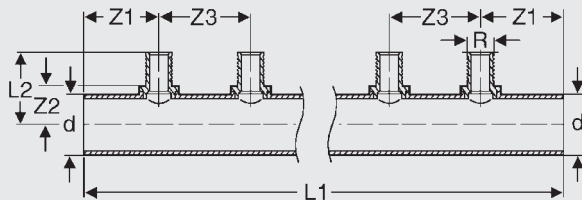

PEX Press Braided Copper Manifold - Headers


Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)
65470	1-1/4" CM x 1/2" PEX Press, 24 outlets	75.0	1905	1.58	40.1	3.00	76.2	0.99	25.1	3.00	76.2
65471	1-1/4" CM x 3/4" PEX Press, 24 outlets	75.0	1905	1.58	40.1	3.00	76.2	0.99	25.1	3.00	76.2
65480	1-1/2" CM x 3/4" PEX Press, 24 outlets	75.0	1905	1.70	43.2	3.00	76.2	1.11	28.3	3.00	76.2

Note: CM = Copper Male

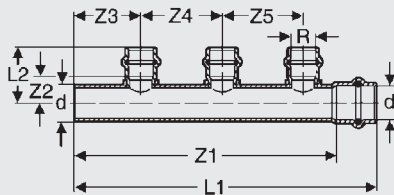

Bronze PEX Press ProPress Copper Manifolds

Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)	Z4 (in)	Z4 (mm)	Z5 (in)	Z5 (mm)
65903	3/4" C x 1/2" PEX Press, 3 outlets	7.32	186.0	1.37	34.7	6.38	162.0	0.78	19.7	1.65	42.0	1.97	50.0	1.97	50.0
65913	1" C x 1/2" PEX Press, 3 outlets	7.32	186.0	1.43	36.3	6.38	162.0	0.84	19.7	1.65	42.0	1.97	50.0	1.97	50.0

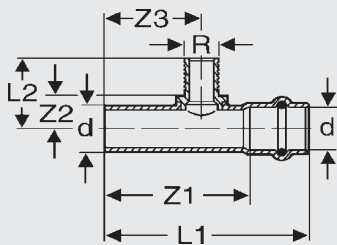


Bronze PEX Press ProPress Copper Manifolds


Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)
65901	3/4" C x 1/2" PEX Press, 1 outlet	3.39	86.1	1.37	34.7	2.48	63.0	0.78	19.7	1.65	42.0
65902	3/4" C x 3/4" PEX Press, 1 outlet	3.39	86.1	1.37	34.7	2.48	63.0	0.78	19.7	1.65	42.0
65911	1" C x 1/2" PEX Press, 1 outlet	3.39	86.1	1.43	36.2	2.48	63.0	0.83	21.2	1.65	42.0
65912	1" C x 3/4" PEX Press, 1 outlet	3.39	86.1	1.43	36.2	2.48	63.0	0.83	21.2	1.65	42.0

Dimensional Documentation


PEX Press Fittings

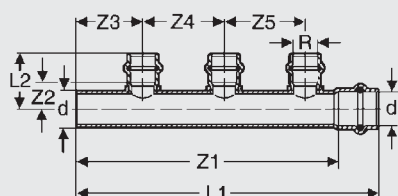

ProPress Copper Manifolds															
Stock Code	d x R (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)	Z3 (in)	Z3 (mm)	Z4 (in)	Z4 (mm)	Z5 (in)	Z5 (mm)
65803	1" C x 1/2" C, 3 outlets	7.32	186.0	1.51	38.4	6.38	162.0	0.76	19.4	1.65	42.0	1.97	50.0	1.97	50.0

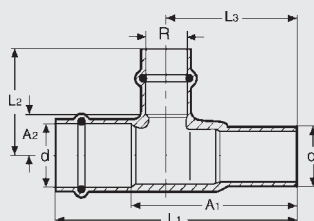


ProPress Copper Manifold											
Stock Code	d x R (size)	A1 (in)	A1 (mm)	A2 (in)	A2 (mm)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	L3 (in)	L3 (mm)
65801	1" C x 1/2" C, 1 outlets	2.69	68.5	0.78	20.0	3.66	93.0	1.53	39.0	2.06	52.5

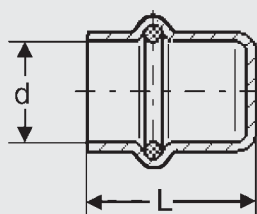


Copper ProPress End Cap			
Stock Code	d (size)	L1 (in)	L1 (mm)
65840	3/4" C	1.067	27.1
65860	1" C	1.110	28.2

Dimensional Documentation


PEX Press Fittings

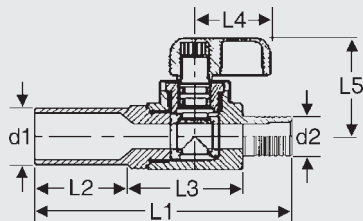


ProPress Copper Manifolds Valves											
Stock Code	d1 x d2 (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	L3 (in)	L3 (mm)	L4 (in)	L4 (mm)	L5 (in)	L5 (mm)
74001	1/2" Copper x 1/2" PEX Press	2.95	74.9	1.00	25.4	1.36	34.5	0.88	22.4	1.20	30.5

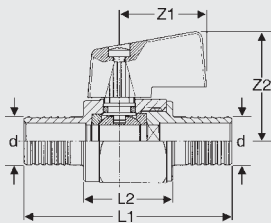

PEX Press Ball Valves									
Stock Code	d (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	Z1 (in)	Z1 (mm)	Z2 (in)	Z2 (mm)
73500	3/8" PEX Press	2.19	55.5	1.00	25.5	0.87	22.10	1.09	27.69
73520	1/2" PEX Press	2.07	52.6	0.89	22.6	0.87	22.10	1.09	27.69
73540	3/4" PEX Press	2.32	59.0	1.14	29.0	0.87	22.10	1.27	32.26

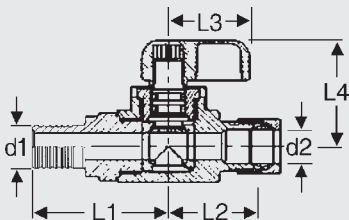


PEX Press Straight Stop Valves, 1/4 Turn									
Stock Code	d1 x d2 (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	L3 (in)	L3 (mm)	L4 (in)	L4 (mm)
73031	1/2" PEX Press x 3/8" OD	1.45	36.83	1.00	25.4	0.88	22.35	1.20	30.48

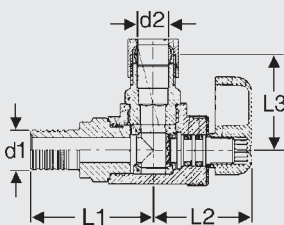

PEX Press Angle Stop Valves, 1/4 Turn							
Stock Code	d1 x d2 (size)	L1 (in)	L1 (mm)	L2 (in)	L2 (mm)	L3 (in)	L3 (mm)
72511	1/2" PEX Press x 3/8" OD	1.45	36.83	1.20	30.48	1.00	25.4

Dimensional Documentation


PEX Press Fittings

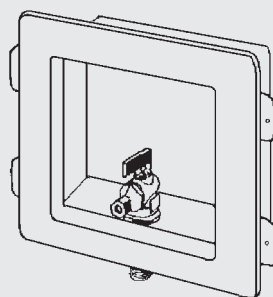

Ice Maker Box

(box dimensions without face plate or valves)

Height: 5-1/4 inches
Width: 5-1/4 inches
Depth: 2-1/2 inches
Face plate: 6-3/4 inches high x 6-3/4 inches wide
Valve: 3/8" or 1/2" PEX Press

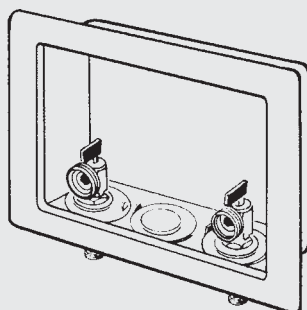

Washing Machine Box

(box dimensions without face plate or valves)

Height: 6-5/8 inches
Width: 7-3/4 inches
Depth: 3 inches
Face plate: 8-1/4 inches high x 10-3/8 inches wide
Valve: 1/2" PEX Press